



Mercedes-Benz

Campaign No. 2021030014, April 2021
Revision A, August 2021

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model AMG GT-Class 4 Door Coupe vehicles (290 platform)**
Model Year 2019-2020
Replace Wheel-Hub Cap

Mercedes-Benz AG (“MBAG”), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Model Year (“MY”) 2019-2020 AMG GT-Class 4 Door Coupe vehicles (290 platform), the wheel-hub caps with the Mercedes-Benz emblem might not have been manufactured according to current production specifications. The fastening clip mechanism on the wheel-hub caps might not withstand induced stresses while driving, and could detach from the wheel hub. If the wheel-hub caps detach from the vehicle while driving, they could become a road hazard, which could increase the risk of a crash or risk of injury for other road users. An authorized Mercedes-Benz dealer will replace the wheel-hub caps on the affected vehicles

Prior to performing this Recall Campaign:

- VMI must always be checked before performing campaigns to verify that the campaign is required on a specific vehicle. Always check for any other open campaigns, and perform accordingly.
- Please review the entire Recall Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

Approximately 1,142 vehicles are involved.

Order No. P-RC-2021030014

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Work procedure

1. Replace wheel hub covers (all).

i Tightening torque of the wheel hub covers see AR40.10-P-1102A.

i Aluminum wheel hub cover on alloy wheel 27Nm (BA40.10-P-1002-01P).

Primary Parts Information

Qty.	Part Name	Part Number
All*(4)	Wheel hub cover	A 000 400 69 00*

* The replacement parts must be determined by VIN via the parts job in the Xentry Portal (XPPI).

i Small parts such as screws, self-locking nuts, sealing rings, cable ties, fluids, sealants, etc. are not listed in the parts list. The required small parts are taken into account in the budgeting.

Warranty Information

Operation: Replace all wheel hub covers (02-1893)

Damage Code	Operation Number	Labor Time (hrs.)
40 900 23 7	02-1893	0.2

i **Note**

Operation Number labor times are subject to change.